


VS2 (XP) Vibration Monitor User's Manual

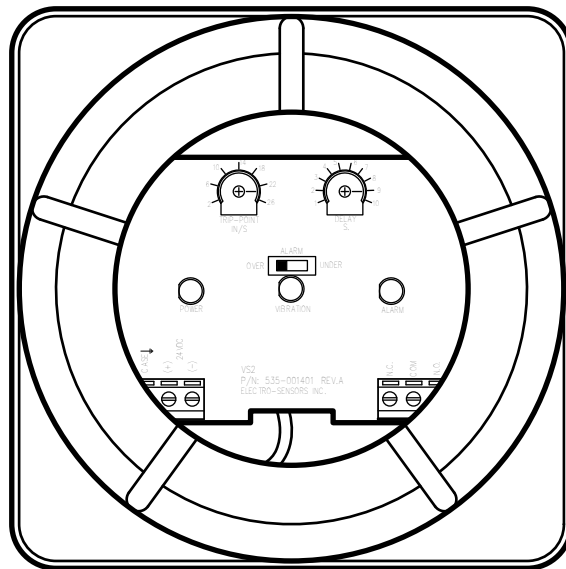


Description

The VS2 (XP) Vibration Monitor combines sensor, circuitry and isolated npn or relay output in a explosionproof housing. It monitors the machine surface to which it is attached and alarms when vibration levels either exceed or fall below the trip-point setting (depending on the ALARM switch setting).

Operator Interface/Dimensions

The setting dials and switch are located under the housing cover. Remove the cover to change settings and replace when finished.

Cover Attached (window cover shown)

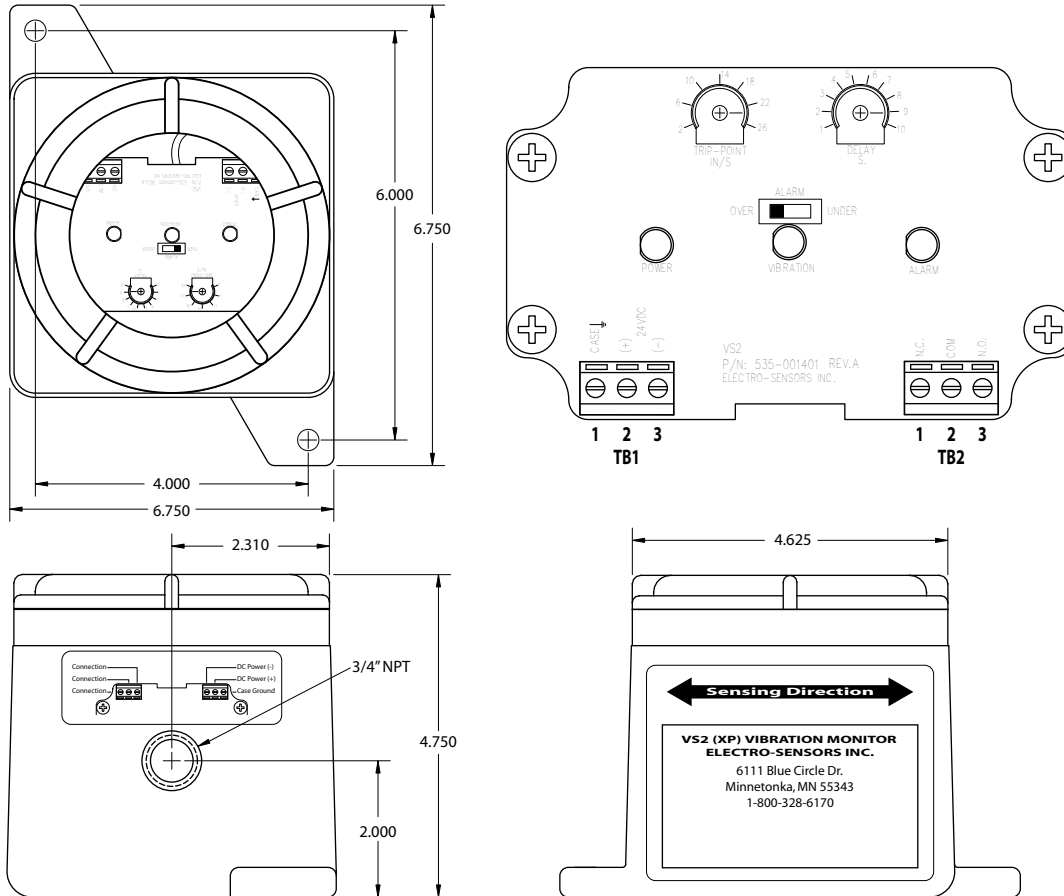

Installation

Orientation

The VS2 (XP) senses vibration along the axis indicated by the SENSING DIRECTION arrows labeled on the housing. Orient the VS2 with the arrows parallel to the vibration axis to be monitored.

Mounting

Rigid, tight attachment is necessary for any vibration-sensing device. Any looseness or rocking will permit error-causing resonance. Therefore, the VS2 (XP) must be tightly and securely bolted to the measurement surface at both mounting tabs.

Terminal Connections

Power

TB1-1	Case
TB1-2	DC Power (+)
TB1-3	DC Power (-)

Output

TB2-1	(NPN Output Option) Emitter	(Relay Output Option) Relay N.C.
TB2-2	Collector Protection Cathode	Relay Common
TB2-3	Collector	Relay N.O.

Operation

Power LED (Green)..... Indicates power applied to the VS2.

Vibration LED (Green) Indicates vibration at or above the minimum detectable level (2 in/s nominal).

Alarm LED (Red)..... Indicates an alarm condition.

Note: Alarms are not latching — an alarm condition persists only while the vibration magnitude stays at alarm levels.

Alarm OVER/UNDER Switch Selects the alarm functionality.

Over: Alarms while vibration magnitude is above the trip-point setting.

Under: Alarms while vibration magnitude is below the trip-point setting.

Trip-Point Dial Sets the alarm level threshold in inches-per-second RMS.

Delay Dial Sets the alarm delay in seconds.

An alarm occurs DELAY seconds after detecting vibration magnitude at alarm level. The vibration magnitude must remain at alarm levels for at least DELAY seconds for an alarm to occur.

NPN Output Option The isolated NPN output is connected for failsafe operation (NPN on when powered and not alarmed).

It operates as follows:

Conducting (ON) when VS2 is powered and not alarmed

Not conducting (OFF) when VS2 is unpowered or alarmed.

Relay Output Option The isolated SPDT relay is connected for failsafe operation (relay is energized when VS2 is powered and not alarmed). The contacts operate as follows:

N.C. Disconnected from COM (energized) when VS2 is powered and not alarmed.

Connected to COM (not energized) when VS2 is unpowered or alarmed.

N.O. Connected to COM (energized) when VS2 is powered and not alarmed.

Disconnected from COM (not energized) when VS2 is unpowered or alarmed.

Settings

With the VS2 (XP) tightly mounted, the cover removed, and 24 Vdc power applied*, complete the following steps:

1. Set the ALARM OVER/UNDER switch as required.
2. Set the TRIP-POINT. If the desired RMS velocity alarm value is known, set the trip point to that value, otherwise it can be set experimentally relative to your machine's current (acceptable) vibration level. The following gives an example (ALARM set to OVER):
 - a. Set the DELAY to minimum (1 second).
 - b. Start the machine to be monitored.

Note: The VIBRATION LED should light, indicating vibrations above the VS2 minimum detectable level (2 in/s). Wait for any/all transient vibrations to die out.
 - c. Slowly increase the TRIP POINT setting until the ALARM LED darkens (if already alarmed).
 - d. Slowly decrease the TRIP POINT setting until the ALARM LED begins to light. This setting is your current vibration level.

Note: These last two steps may need to be repeated. Adjust the TRIP POINT slowly since there is a minimum of 1 second response time.
 - e. Increase the TRIP POINT to a value proportional to the current vibration level. For example, if the current vibration level is 10 in/s and you want the VS2 to alarm at 40% above that, set the trip point to 14 in/s.
3. Set the DELAY. This may also have to be determined experimentally, depending on the duration of vibration transients to be ignored.
4. Re-attach the cover tightly.

* Note: There is a 10-15s. delay from application of DC power to becoming operational (to allow internal circuitry to charge).

Specifications

LED Indicators

Power	Green
Vibration	Green - indicates vibration above min. detectable level (2 in/s rms)
Alarm	Red - indicates output in alarm state

Settings/Ranges

Alarm trip point	2 - 26 in/s (51 - 660 mm/s) rms
Alarm delay	1 - 10 seconds
Alarm	Over/under select switch

Operational Limits

Min. vibration frequency (-3db)	1 Hz
Max. vibration acceleration	± 50 g peak (NPN option) ± 12 g peak (Relay option)

Power Requirements

Voltage	24 Vdc (18 - 30 Vdc)
Current (max)	30 mA @ 24 Vdc
<i>Note: Optional 24 Vdc/130 mA power supply available, consult factory.</i>	

Relay (Relay option)

Type	SPDT
DC Rating	5A @ 30 Vdc
AC Rating	5A @ 250 Vac
Failsafe	Relay energized when powered and not alarmed

Isolated NPN Output (NPN output option)

Current	50 mA
V_{CE} (max @ 50 mA)	1.0 V
BV_{CEO} (breakdown volts)	100 V
P_D (max power over temp)	100 mW
I_{CEO} (max leakage over temp)	100 μ A
Failsafe	Transistor ON when powered and not alarmed

Enclosure Ratings

UL LISTED	Class I, Div 1, Group C, D
	Class II Groups E, F, G
	UL File: E249019
CSA	(C22.2 No. 30-M1986 file #LR11716)
FM	(#3600 & 3615 file #2Y4A5.AE)
NEMA	3, 4, 4X, 7(B,C,D), 9(E,F,G)

Environmental


Operating Temperature:	
(NPN Option)	-40°C to 85°C/-40°F to 185°F
(Relay Option)	-40°C to 65°C/-40°F to 149°F

Mechanical

Weight:	
(Window cover option)	5.90 lb (2.68 kg)
(Blank cover option)	5.70 lb (2.59 kg)


Specifications subject to change without notice.

NPN Output Schematic and Possible Connections (NPN Output Option)

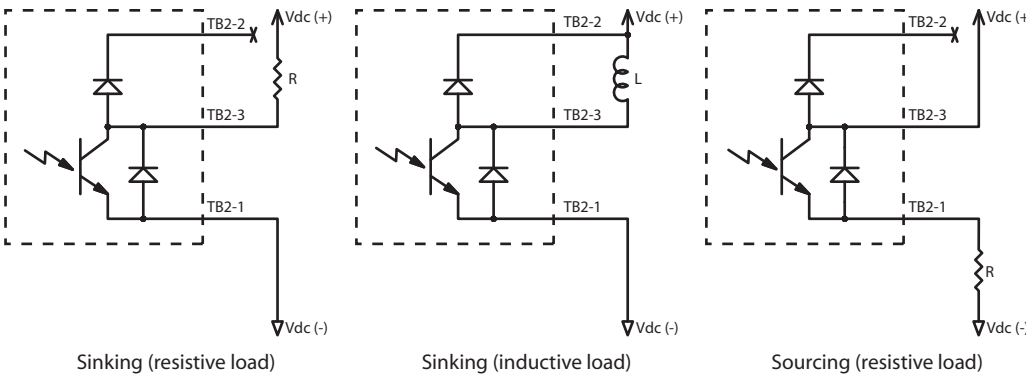

The NPN output is electrically isolated from the VS2 DC power inputs and case. The NPN output may be externally connected to the same supply as the DC power inputs or to a different supply.

Relay Output Schematic (Relay Output Option)

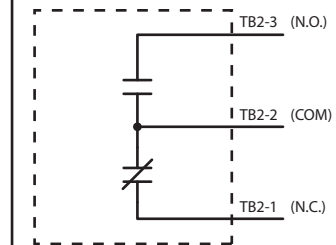

The relay output is electrically isolated from the VS2 DC power inputs and case

Useful Conversion Formulas

Definitions:

CPM	Machine cycles per minute
f	Frequency
Stroke	Max machine travel (peak to peak)
Disp_{pk}	Peak displacement from center position (Stroke / 2)

Formulas:

f (frequency in Hz)	$= \text{CPM} / 60$	
Vel_{rms} (rms velocity in in/s)	$= 4.44 * \text{Disp}_{pk} * f$	Disp _{pk} must be in inches, f must be in Hz
Accel (peak acceleration in g's)	$= 0.103 * \text{Disp}_{pk} * f^2$	Disp _{pk} must be in inches, f must be in Hz
Accel (peak acceleration in g's)	$= 0.0231 * \text{Vel}_{rms} * f$	Vel _{rms} must be in in/s rms, f must be in Hz

Note: All formulas based on sinusoidal motion.

Free Catalog and Application Assistance:

1-800-328-6170

ISO9001:2000

6111 Blue Circle Drive, Minnetonka, MN 55343 USA



Superior • Systems • Solutions

www.electro-sensors.com

Visit us online:

Phone: 952-930-0100 Fax: 952-930-0130